MARION COUNTY SURVEYOR'S OFFICE

SECTION CORNER RECORD

DEBRA S. JENKINS MARION COUNTY SURVEYOR

SEC. 22 TWN. 14_{N} RNG. 2_{E}

BRYAN F. CATLIN, PLS TECHNICAL SUPERVISOR

Date: 5-7-10

Party Chief: Greene / Wilcoxen

Crew: Taylor

Type of Marker: Harrison


Method of Establishment: County: 3-15-1996

162.85'

163.48

IN S.P.C. E Zone, NAD 83 (1986)

Name: 14022202 N: 488 548.825 9(m) E: 45 824.780 5(m)

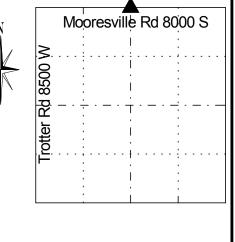

Mooresville Rd 8000 S

₹5.70' × □×-× □× □×-× □ 4.

Corner originally set as a post in 1820 by Wm. B. Laughlin with the following witnesses: 10" Beech bearing N 38 E 16 links and a 10" Beech bearing S 71 W 18 links (Marion County Atlas p. 3). A survey by H.B. Fatout on September 6, 1877 indicates a rock set with the following witnesses: 20" Grey Ash bearing S 12½ E 78½ links 15" Grey Ash S 9½ W 66 links and a 24" Beech bearing N 19 E 48 links and a 24" Beech bearing N 7 W 60 links (Decatur Legal Book p. 28). Corner referenced by Bookedis on 8/28/1967 and called a PK nail over RR spike. Corner referenced by Wilcoxen on 3/23/90 and called a RR spike. Corner excavated by Wilcoxen on 5/31/90 and a RR spike was found at surface. A RR spike was found 9"down also. No stone was found during excavation. A # 205 cast iron Harrison Monument was set in position as the corner. Wilcoxen retied 3/15/1996. Wilcoxen retied 12/31/2000. Kiste retied 10/4/06. Wilcoxen retied 5/7/10 and a 3" riser was put on existing monument.

REF	DISTANCE	DESCRIPTION
1.	35.23'	Top nut of fire hydrant
2.	101.25'	Southern face of steel mailbox post
3.	85.70'	PK nail N PwP #53-771Z 12" up
4.	25.31'	NW corner of plastic fence post
5.	163.48'	NE corner of concrete headwall
6.	162.85'	SE corner of concrete headwall
7.	24.05'	Road nail w/washer W PwP #19-771YA 10" up